

Richardson & Starling

Building Preservation and Refurbishment

Survey Report



**Property Surveyed: 178 Dumbarton Road, Flats 1-1 & 1-2,
Glasgow, G**

Prepared for: Glasgow City Building

Prepared by: Melvin Niven c.s.r.t. c.s.s.w.

Date of Survey: 13th July 2023

Celebrating 85 Years in Business



Richardson & Starling (Northern) Limited
8 Cambuslang Way
Glasgow, G32 8ND

Tel: 0141 647 9485
Email: glasgow@woodrot.com
www.richardsonandstarling.co.uk

18th July 2023

Our Ref: MN/MB/23/1357

Glasgow City Building
350 Darnick Street
Glasgow
G21 4BA

FAO: Mr MacAuley Wood

Dear Sir,

Property Surveyed: 178 Dumbarton Road, Flats 1-1 & 1-2, Glasgow.

In accordance with your verbal instruction our surveyor, Melvin Niven visited the above property on 13th July 2022 to investigate the exposed mid-floor joists. We now submit our findings.

For reference purposes all directions are taken from outside the property facing the front elevation.

Property Description

The inspected properties are traditional 1st floor tenement flats.
commercial premises.

Weather Conditions

During our survey it was overcast and dry.

Internal Observations

1st Floor Level

Flat 1-1

Area (A) Room Front Left (Kitchen)
Area (B) Room Front Right
Area (C) Room Centre Left (Bathroom)
Area (D) Hallway
Area (E) Room Rear Left
Area (F) Room Rear Right

Our inspection to the exposed mid-floor joists at the front and rear elevation wall and bathroom revealed extensive previous repairs have been carried out to the joists, deafening and flooring.

Superficial decay by the wet rot fungus (*Coniophora Puteana*) was noted to 1 No joist at the window opening of area (E), however as the decay is superficial and the cause of the decay has been repaired, we see no need for further treatments.

Property Care Association Member

Registered in England No. 944470
Registered Office: Pacific House, Parkhouse, Carlisle, CA3 0LJ

Due to defective plumbing to the property above, the ceiling of the bathroom has collapsed and the chipboard to the flooring has perished.

We recommend that cause of the leak be rectified and that the mid-floor joists be dried. It is anticipated that the water damaged deafening and deafening boards will require to be renewed.

1st Floor Level

Flat 1-2

Area (G) Room Front Left
Area (H) Room Front Right (Kitchen)
Area (I) Room Centre Right (Bathroom)
Area (J) Hallway
Area (K) Room Rear Left
Area (L) Room Rear Right

Again, extensive repairs have been carried out to the floor joists.

Defective plumbing has damaged the ceiling to the bathroom.

We recommend that cause of the leak be rectified and that the mid-floor joists be dried.

Recommendations

No treatments required on the basis of this inspection.

We hope the contents of the report are clear, however, should you require further information please do not hesitate to contact our Surveyor who will be pleased to assist you.

Yours faithfully
For and on behalf of Richardson & Starling.



Melvin Niven C.S.R.T. C.S.S.W
Senior Surveyor
melvin.niven@woodrot.com
Mobile 07764 474350



Richardson & Starling

Why Choose Us?



Delivering Property Care Since 1935

We have been delivering solutions to property problems for over 85 years and aim to give our clients a quality service they can trust.



Reviewed & Recommended

More than 800 positive reviews and recommendations left on Google, TrustPilot, Yell.com, Yelp.com, Reviews.co.uk and Facebook. Visit our website to see what our clients say about us.



Guarantees You Can Trust

Our guarantees on remedial work range from 5 to 30 years. All our guarantees are fully transferable to new owners if the property is sold to give you and them peace of mind.



No Deposit Required

No payment is required to get the job started and most contracts are not paid until the works are complete. (Large jobs may have interim payments)



**CONTRACTOR
OF THE YEAR
2016-18**

Award-Winning Contractor

Property Care Association 'UK Contractor of the Year' three times in a row 2016-2018. Our customer service and repair standards have gained us multiple industry awards.

Fully Accredited & Certified Specialists



For more information please visit our website

www.richardsonandstarling.co.uk